# **Carbon Steel Ball Valve**



# 3 Piece 4 Bolt Enclosed • Standard Port • Threaded Connection • 2000 WOG • Stainless Steel Ball and Stem



T-CS-2001N-SS-4B


#### **Features**


- Latch lock may be locked in open or closed position
- Solid ball construction
- Blow out proof stem
- 29 in-Hg vacuum rating
- Fire safe rated
- 100% leak tested
- Wetted surfaces contain less than .25% lead content
- Repair kits available

## Approvals ( U) III

- UL Listed
  - MHKZ Manual valves
  - YQNZ Compressed gas shut-off valves
  - YRBX Flammable liquid shut-off valves
  - YRPV Gas shut-off valves
  - YSDT LP gas shut-off valves
  - YQAR Anhydrous ammonia shut-off valves
- API 607 (4th edition) fire safe rated
- Conforms to API 598
- NACE Certified
- MSS SP-110, SP-61, SP-82
- ASME B16.34 (1/2" 1-1/4")
- ANSI B1.20.1
- ANSI B16.11

### Valve Seat Rating

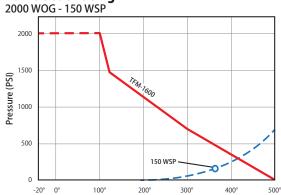

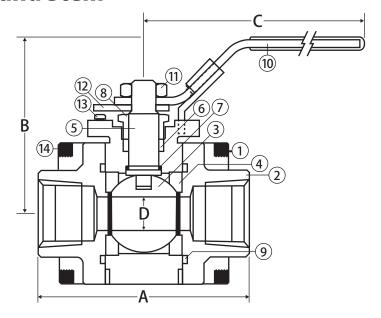

### **Material Specifications**

material specifications								
No.	Part	Materials						
1	Body	WCB Carbon Steel						
2	End Cap (2)	WCB Carbon Steel						
3	Ball	CF8M Stainless Steel						
4	Seat (2)	Hostaflon® TFM 1600						
5	Stem	316 Stainless Steel						
6	Packing (2)	RPTFE						
7	Stem Seal	Hostaflon® TFM 1600						
8	Packing Gland	1045 Carbon Steel						
9	Body Seal (2)	Grafoil						
10	Handle	A283 Carbon Steel						
11	Handle Nut	304 Stainless Steel						
12	Stop Plate	304 Stainless Steel						
13	Lock Pin	304 Stainless Steel						
14	Body Bolt (8)	A193-B7 Steel						

#### **Dimensions**

Part No.	Size	Α	В	С	D	Torque
601-613	1/2"	2.72	2.47	4.15	0.43	85
601-614	3/4"	2.94	2.70	4.15	0.55	150
601-615	1"	3.50	3.19	5.00	0.81	180
601-616	1-1/4"	3.90	3.64	5.98	0.98	210
601-617	1-1/2"	4.42	3.88	7.76	1.25	320
601-618	2"	5.04	4.09	7.76	1.50	440



WARNING: This product can expose you to chemicals including diisononyl phthalate (DINP), which is known to the State of California to cause cancer, and diisononyl phthalate (DINP), which is known to the State of California to cause birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.